

Optimisation of the air suspension bracket for FB100 air suspension units


Progressively starting in the 2nd quarter of 2023

General aspects


As part of the ongoing optimisation of GIGANT products, the air suspension bracket on air suspension units with 100 mm spring width (FB100) were examined in more detail with regards to the coatings for immersion baths.

The conversion of the air suspension bracket will begin progressively starting in the 2nd quarter of 2023.

Air suspension bracket until 2023

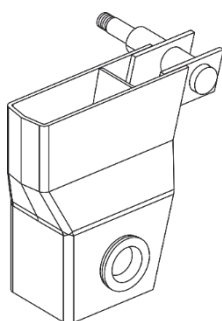


Air suspension bracket with drain holes starting in the 2nd quarter of 2023

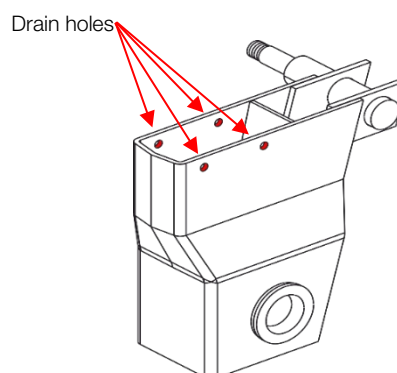

What will change?

- Two drain holes with a diameter of 11 mm will be added on each side of the air suspension bracket approx. 15 mm from the upper edge.
- When positioning the lateral supports or reinforcements plates on the chassis, it must be ensured that they are placed at least 20 mm away from the drain holes.

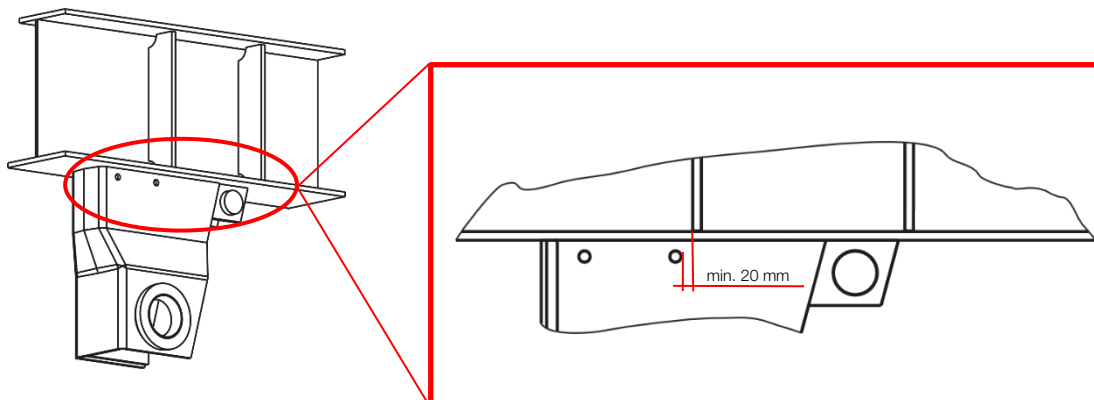

Note

- This TM02/2023 is a supplement to the installation guidelines GN0040-2 for air suspension units FB100.

The GIGANT team is happy to answer any questions you may have and wishes you a safe journey.

Created/reviewed:

Approved:

2023.04.24	HU	2023.04.25	AK
Date	Signature	Date	Signature